


DRIP...DRIP...DRIP

THIS IS *VERY* EMBARRASSING!

Leaks around the plastic plug, NSN 4730-01-086-1620, under your water trailer probably means it was overtightened when it was first installed.

Overtightening strips threads, causing leaks. It also makes the plug hard to remove.

So head off leaks and removal problems by wrapping every new plug's threads with anti-seize tape, NSN 8030-00-889-3535, and by lightly snugging it in place. That way, the plug can be used several times.

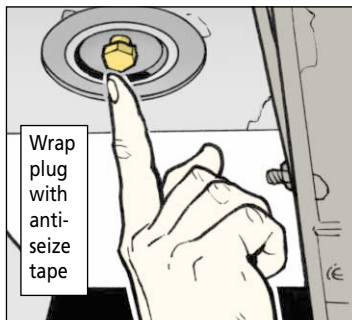

M1000 HET Semitrailer...

Ramps Get Dry Lube

Solid film lubricant (SFL), not grease, is the required lube for the ramp pivot shafts and spring rod guides on M1000 HET semitrailer ramps.

SFL lubes the shafts and guides, without attracting dirt, grit and sand like grease. The grease-dirt-grit-sand combination works like sandpaper to score the surface of ramp pivot shafts and guides.

If your semitrailer's pins or guides now have grease on them, remove it with dry cleaning solvent. Then use SFL, NSN 9150-00-754-0064.

